


- Button function:
 - in/mm: short press for inch/metric conversion
long press to change measuring direction
 - ABS: short press for absolute/incremental measurement
long press to preset data
 - 0/ON: short press to turn on when power is off
short press to set zero when power is on
long press to turn off
- Keep preset data in memory after restart
- CR1632 battery, automatic power off
- Data output
- Optional accessory: data output cable
(code **7315-50M**, **7302-40M**, **7305-40M**),
contact points (page 173~175)



2114-51F

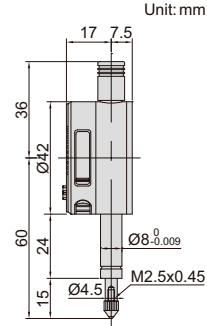

Code	Range	Resolution	Accuracy	Hysteresis	Remark
2114-5F *	5mm/0.2"	0.01mm/0.0005"	20μm	10μm	flat back
2114-51F *	5mm/0.2"	0.001mm/0.00005"	5μm	2μm	flat back

* Supplied with manufacturer inspection certificate traceable to NIST USA